


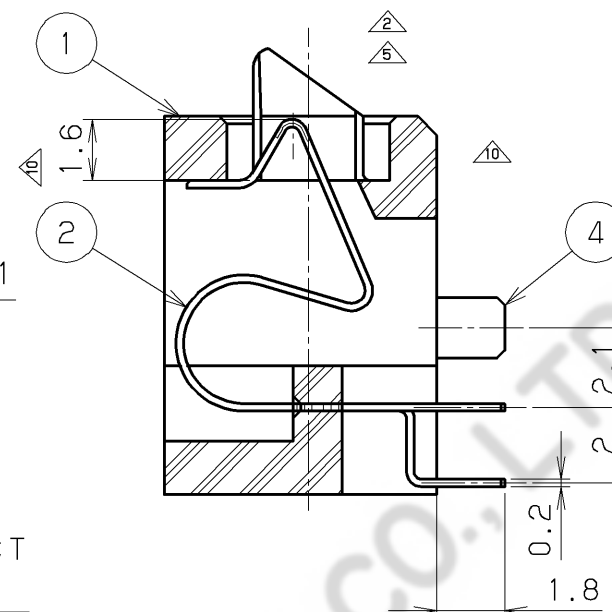
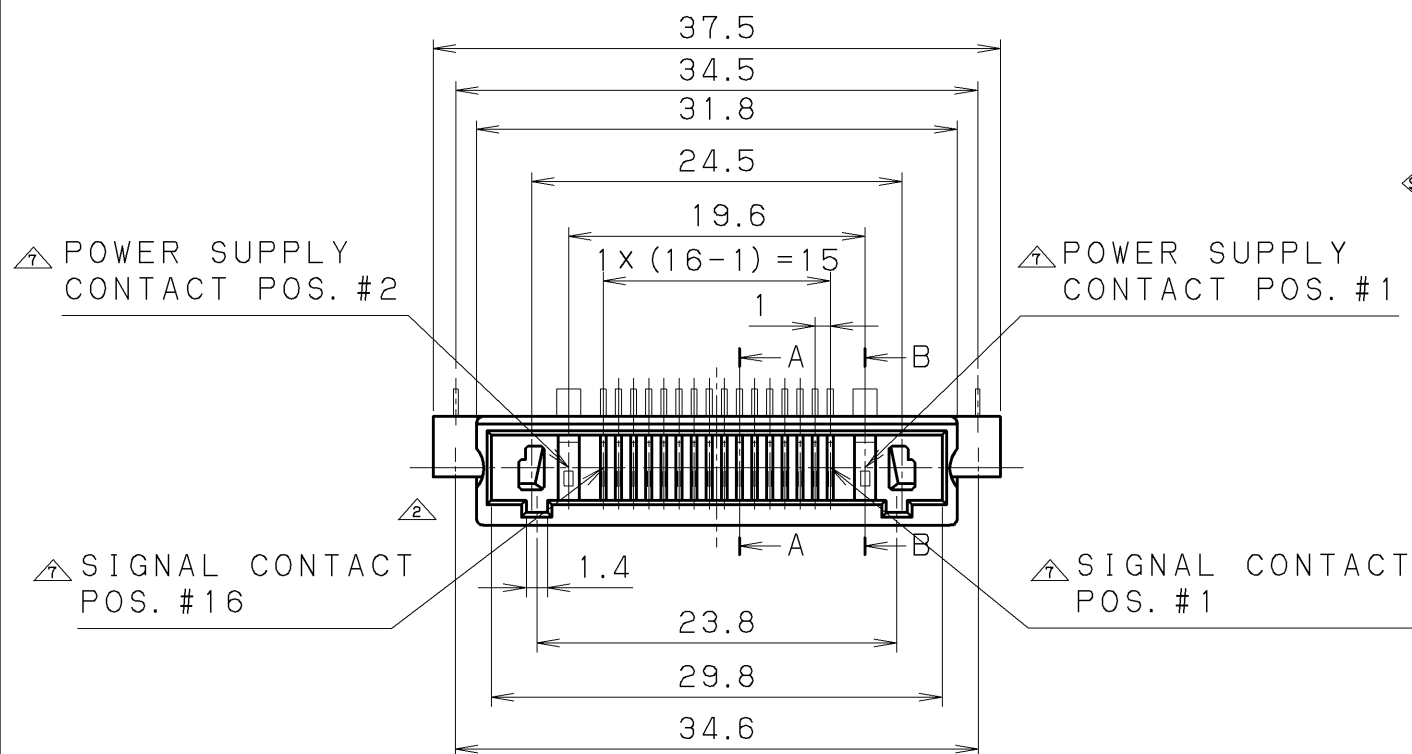
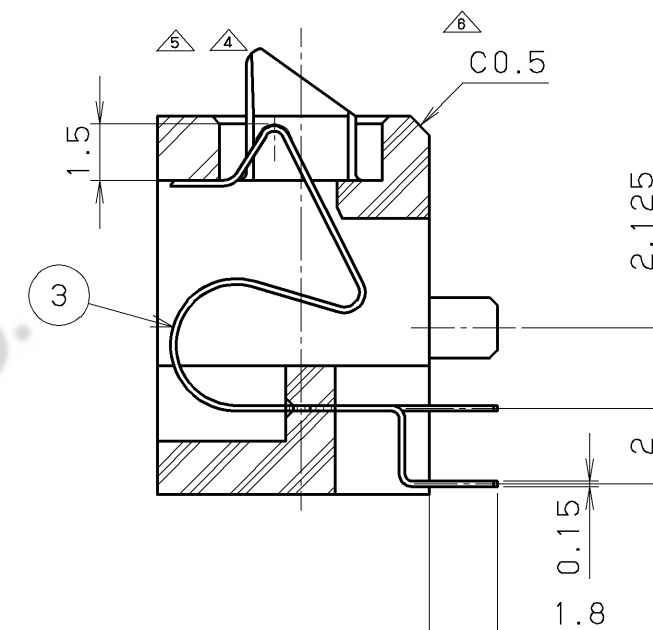


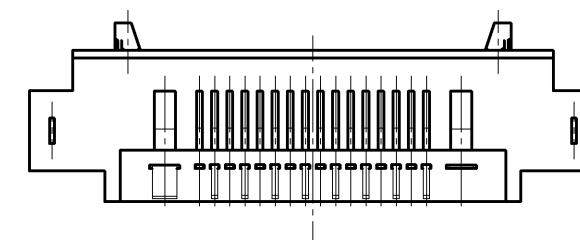


AA Section
(S=5/1)

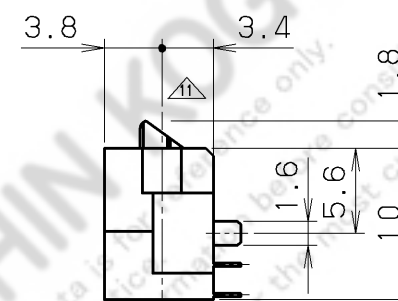

BB Section
(S=5/1)

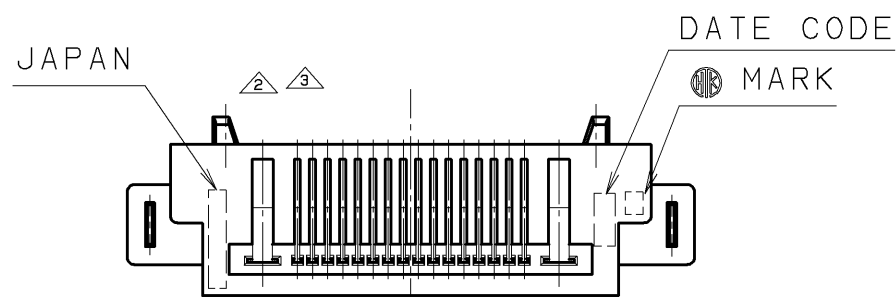

HONDA
PRINT RM
JAN.18, 2007
ISSUED

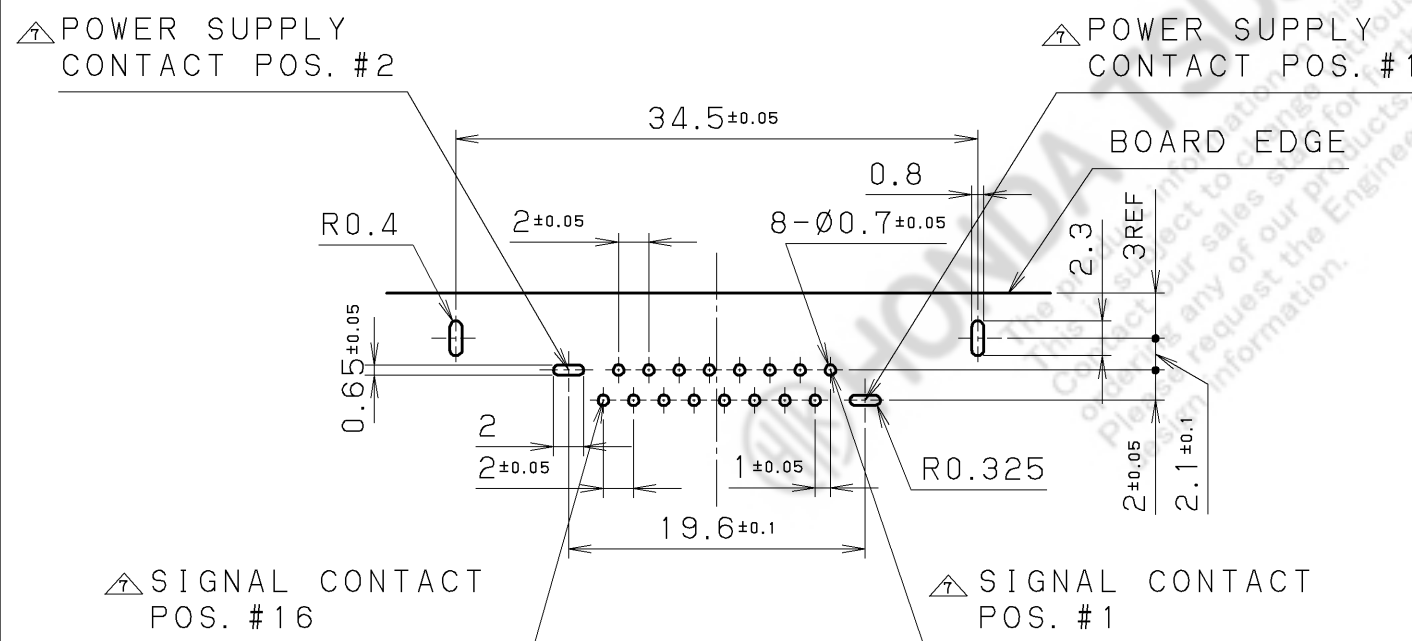

RECOMMENDED PCB LAYOUT
(CONNECTOR SIDE) t=1.0

RoHS compliant

NOTE 1. Contact plating
Contact area: Gold 0.2μm
Dip area: Gold 0.05μm
All over nickel underplated.

NOTE 2. This product does not have
the continuity to the ground.

12	JAN.11 2007	K.00AKU	CHANGED FINISH
11	NOV.01 2005	K.ONO	DELETED DIMENSION (0.45)
10	SEP.03 2004	K.ONO	CHANGED SHAPE etc.
9	JUN.11 2004	K.00AKU	ADD NOTE 2
8	FEB.23 2004	K.00AKU	CHANGED MATERIAL
7	MAR.18 2003	T.ODA	ADD CONTACT NUMBER
6	NOV.22 2001	K.ONO	CHANGED SHAPE
5	OCT.22 2001	K.ONO	CHANGED SHAPE
4	OCT.11 2001	K.ONO	CHANGED SHAPE
3	AUG.07 2001	K.ONO	CHANGED SHAPE
2	JUL.12 2001	K.ONO	CHANGED SHAPE
1	JUN.29 2001	K.ONO	CHANGED SHAPE

LTR.	DATE	BY	REV.	DESCRIPT	No.	PART NAME	MATERIAL	QTY	FINISH	NOTE
	DATE MAY.30 (2001)		SCALE 2/1	UNIT mm (INCH)	3RD. A. P	HONDA TSUSHIN KOGYO CO., LTD.				
	APP. DATE&REV.					NAME	Female Connector Right Angle Dip Type			
	DR.	DE.	CHK.	CHK.	APP.	PART NO.	BCL-C18LFDG1			REV. 12L
	K.00AKU	K.00AKU	—	—	K.KASHIO					